MARION COUNTY SURVEYOR'S OFFICE

SECTION CORNER RECORD

DEBRA S. JENKINS MARION COUNTY SURVEYOR

SEC. 36 TWN. 15_{N} RNG. 4_{E}

8


21.82°

5.

3.

75%

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

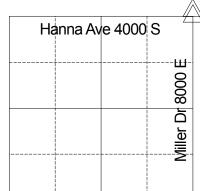

Date: 5-22-09
Party Chief: Greene
Crew: Taylor / Finney
Type of Marker: RR spike set at surface

Method of Establishment: County: 4-9-1996 IN S.P.C. E Zone, NAD 83 Name: 15043603

Hanna Ave 4000 S

6. (PWP)

Name: 15043603 N: 495 427.314 0(m) E: 69 224.181 0(m)

Corner originally set as a post in 1820 by John Hendricks with the following witnesses: 18" beech bearing S 26 W 10 links and a 25" dogwood bearing S 79 E 26 links (Marion County Atlas p. 10). A survey by D.B. Hasbrook on March 14,1851 indicates no stone but the following witnesses: 8" beech bearing N 69.50 W 15.50 links and a beech bearing S .75 degrees 32 links (Franklin Legal Book p. 5). A survey by H.B. Fatout on Nov 7, 1883 indicates a set stone with the following witnesses: 15" beech bearing S 13.50 E 54 links and a 26" sycamore bearing N 80 E 27 links (Franklin Legal Book p. 5). Corner referenced by McLand in 1970 and called a RR spike. Corner referenced by Wilcoxen on 3/5/86 and called a 1" rebar. Corner referenced by Whiteside on 4/9/1996 and called a 1" rebar. Corner referenced by Whiteside on 9/6/06 and called a 1" rebar. Corner referenced by Greene on 5/22/09 and called a set RR spike at surface over 1" rebar 3" down.


REF.	DISTANCE	DESCRIPTION
1.	7.98'	Cut 'x' N rim Storm Sewer manhole
2.	21.28'	Cut 'x' N rim sanitary sewer manhole
3.	21.82'	NE corner brick garage/shed
4.	12.50'	NW corner brick garage/shed
5.	28.40'	SW corner brick garage/shed
6.	32.83'	PK nail N PwP #31-679 12" up

MARION COUNTY SURVEYOR'S OFFICE

SECTION CORNER RECORD DEBRA S. JENKINS MARION COUNTY SURVEYOR

SEC. 36 TWN. 15n RNG. 4e

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

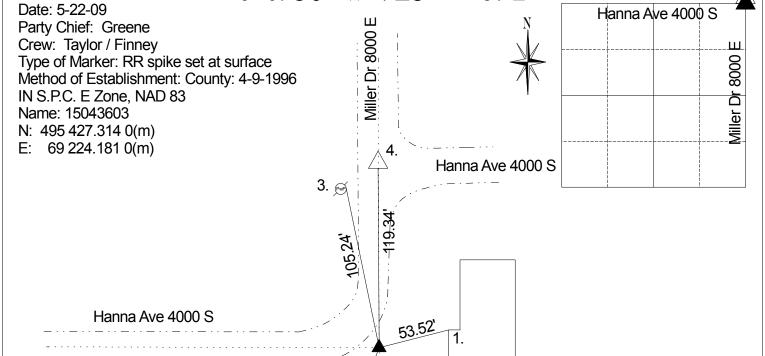

REF.	DISTANCE	DESCRIPTION
1.	53.52'	Due E to westerly corner of brisk home
2.	112.60'	SE corner of brick home
3.	105.24'	PK nail E PwP no #
4.	119.34'	Due N to Harrison NW 31-15-5 (159 links per Hendricks)